



*heating and plumbing products
that won't cost the **earth***

Using solar trade tools

January 2010



Using solar trade tools

Making pipe connections to stainless steel solar pipe is an easy process when you use our Inta Inox pipe cutter and flanging tools. Here's how.



1

Cut solar pipe to length with an Inta Inox pipe cutter. Do not use a hacksaw.



2

Place the nut on the pipe and then clamp the bar leaving 3 ridges of pipe above the jaws.



Inta Inox pipe cutter



3

Centre the flange forming tool and angle it to grip the clamp.



4

Compress the pipe by winding down the handwheel. Use the ratchet action to tighten until flat. The flange is now formed.



Inta Inox flanging tool



5

Look for an even and flat surface to the newly made flange.




6

Now place a "C" clip behind the flange. This ensures that the brass union nut does not damage the flange on tightening.



female thread with c clip & gasket

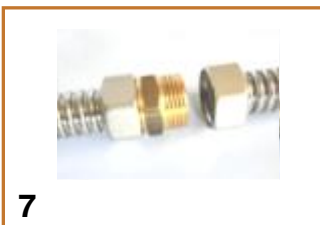

7

Tighten the fitting to form the solar pipe connection.



8